


Smoke and Dye-Water Observation Summary

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

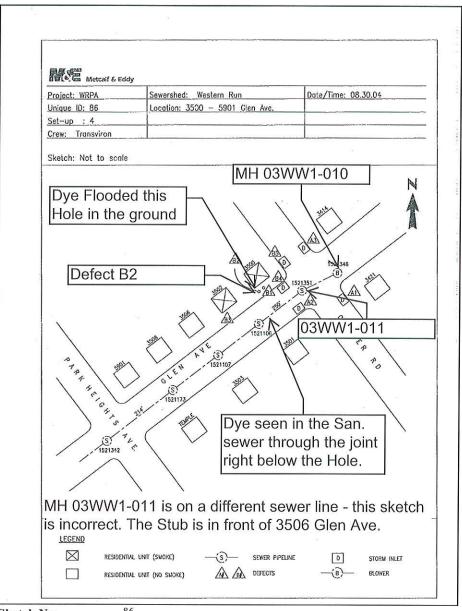

Sketch No:

86

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\86.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.

Dye Flooded this
Hole in the ground

Dye seen at the
joint directly below the Hole

GUELLA AND

1. POSITIVE	1. MAIN SEWER	5. DOWN SPOUT	9. STAIRWELL DRAI	13. STORM DRAIN
2. NEGATIVE	2. SERVICE LINE	6. DWNSPT CONN.	10. FOUNDATION DRAIN	14. CATCH BASIN
3. CANNOTTEST	3. TRANSITION JOIN	7. AREA DRAIN	11. BUILDING INTERIOR	15, STORM MH
	4. CLEAN OUT	8. DRIVEWAY DRAIN	12. MH FRAME/SEAL	16, STORM DITCH
ditional Comments:	DYE SEE	N ATT TO	DIAT, DI	RECTLY
BRLOC	o Holl	IN GRE	m ns B	1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2



Savin Engineers, P.C. 3 Campus Drive Pleasantville, NY 10570 Tel: (914) 769-3200, Fax: (914) 747-6686

INSPECTION REPORT

DATE: 03/29/2005	WORK ORDER:	WEATHER: CLOUDY,DRY	OPERATOR: J.A.M.	SECTION NR: 16	SECTION NAME:
PRESENT:	VEHICLE: TV 175	CAMERA: PAN/TILT	PRESET:	CLEANED: NO	RATE: 500

 STREET:
 GLEN AVE. TEST 86 B 2
 MAP #1:
 1
 MH:
 1521351

 CITY:
 BALTIMORE
 MAP #2:
 MH:
 STUB

LOCALE: MAIN RESIDENTIAL STREET TAPE #: JAM 2 TV'D LGTH: 56.54 ft

INSPECT REASON: DYE TESTING PIPE SIZE: 8 in

SECTION TYPE:

MATERIAL: VCP JT LGTH: 3 ft

AREA: 01-WR19 LINING: NO RELINING
RSRVD:

REMARK: DYE TEST # 86 B 2

56.54

STUB

1:150 DIST OBSERVATION RATE VCR # PH

0.00 inspection begins at downstream manhole, 1521351 0 00:05:26

52.92 pipe broken at joint at 01 o'clock, WITH INFILTRATION 3 00:10:09 7a, b

inspection ends 0 00:10:29



Savin Engineers, P.C. 3 Campus Drive Pleasantville, NY 10570 Tel: (914) 769-3200, Fax: (914) 747-6686

INSPECTION IMAGES

CITY:	STREET:	DATE:	SECTION NR:	SECTION NAME:
BALTIMORE	GLEN AVE. TEST 86 B 2	03/29/2005	16	



IMAGE: 7a, TAPE #: JAM 2, 00:10:09 52.92FT, pipe broken at joint at 01 o'clock, WITH INFILTRATION



IMAGE: 7b, TAPE #: JAM 2, 00:10:09 52.92FT, pipe broken at joint at 01 o'clock, WITH INFILTRATION